

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL HARDWARE

NUMBER: 03-1-0231 -X

SUBSYSTEM NAME: MAIN PROPULSION

REVISION: 2 07/14/00

PART DATA

	PART NAME	PART NUMBER
	VENDOR NAME	VENDOR NUMBER
LRU	: LO2 MANIFOLD RELIEF SHUTOFF VALVE CLOSE SOLENOID UNITED SPACE ALLIANCE - NSLD	MC284-0404-0032, -0042 13111-5, -6

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

VALVE, SOLENOID, NORMALLY CLOSED, 3 WAY, 1/4 INCH. LO2 FEEDLINE RELIEF SHUTOFF VALVE CONTROL., CLOSING.

VALVE WAS ORIGINALLY DESIGNED AND MANUFACTURED BY WRIGHT COMPONENTS (NOW PERKIN ELMER) BUT IS NOW MANUFACTURED BY UNITED SPACE ALLIANCE-NSLD AS AN ALTERNATE PRODUCTION AGENCY.

REFERENCE DESIGNATORS: LV24

QUANTITY OF LIKE ITEMS: 1

FUNCTION:

THE SOLENOID VALVE CONTROLS PNEUMATIC PRESSURE TO CLOSE THE NORMALLY OPEN LO2 FEEDLINE RELIEF SHUTOFF VALVE (PV7). THE SOLENOID VALVE (LV24) MUST DEACTUATE TO ALLOW THE VALVE ACTUATOR TO VENT SO THE LO2 FEEDLINE RELIEF SHUTOFF VALVE CAN OPEN. THE RELIEF SHUTOFF VALVE IS MAINTAINED CLOSED FROM START OF PROPELLANT LOADING UNTIL MECO. VALVE IS MOUNTED ON THE INBOARD FILL & DRAIN VALVE BODY.

FAILURE MODES EFFECTS ANALYSIS FMEA -- CIL FAILURE MODE**NUMBER: 03-1-0231-04****REVISION#:** 2 07/14/00**SUBSYSTEM NAME:** MAIN PROPULSION**LRU:** LO2 MANF RELIEF S/O VLV CL SOLENOID (LV24)**CRITICALITY OF THIS****ITEM NAME:** LO2 MANF RELIEF S/O VLV CL SOLENOID (LV24)**FAILURE MODE:** 1R2**FAILURE MODE:**

PREMATURE DEACTUATION (LO2 RELIEF SHUTOFF VALVE FAILS TO REMAIN CLOSED, REFERENCE FMEA/CIL 03-1-0414-03) CAUSING ACTUATOR CLOSING PRESSURE TO VENT DURING LOADING AND ENGINE OPERATION.

MISSION PHASE: PL PRE-LAUNCH
LO LIFT-OFF

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

102	COLUMBIA
103	DISCOVERY
104	ATLANTIS
105	ENDEAVOUR

CAUSE:

PIECE PART STRUCTURAL FAILURE, ELECTRICAL SOLENOID FAILURE

CRITICALITY 1/1 DURING INTACT ABORT ONLY? NO

REDUNDANCY SCREEN

- A) PASS
- B) PASS
- C) PASS

PASS/FAIL RATIONALE:

A)

B)

PASSES B SCREEN SINCE THE LO2 RELIEF SHUTOFF VALVE (PV7) CLOSE POSITION SWITCH WILL NOT INDICATE "ON". SOLENOID VALVE DOES NOT HAVE POSITION INDICATOR.

C)

- FAILURE EFFECTS -

(A) SUBSYSTEM:

CAUSES PV7 RELIEF SHUTOFF VALVE TO OPEN, RESULTING IN LOSS OF REDUNDANCY FOR PREVENTION OF LO2 OVERBOARD LEAKAGE. FEEDLINE RELIEF VALVE (RV5) WILL PREVENT OVERBOARD LEAKAGE OF LO2 (RELIEF VALVE CRACK PRESSURE IS ABOVE NOMINAL SYSTEM OPERATING PRESSURE).

**FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE
NUMBER: 03-1-0231-04**

(B) INTERFACING SUBSYSTEM(S):

SAME AS A.

(C) MISSION:

ON GROUND, VIOLATION OF THE PV7 RELIEF SHUTOFF VALVE POSITION LCC REQUIREMENT WILL RESULT IN LAUNCH SCRUB.

(D) CREW, VEHICLE, AND ELEMENT(S):

NO EFFECT.

(E) FUNCTIONAL CRITICALITY EFFECTS:

CASE 1:

1R/2 2 SUCCESS PATHS. TIME FRAME - PRELAUNCH.

- 1) LO2 RELIEF SHUTOFF CLOSING SOLENOID VALVE (LV24) PREMATURELY DEACTUATES.
- 2) RELIEF VALVE (RV5) FAILS TO REMAIN CLOSED.

LO2 WILL DUMP OVERBOARD RESULTING IN PROPELLANT LEAKAGE ON TO THE PAD SURFACE. FIRE/EXPLOSION HAZARD EXTERIOR TO THE VEHICLE AND ON THE PAD. FIRE AND/OR LEAKAGE MAY BE DETECTABLE USING TV CAMERAS AND FIRE DETECTOR SENSORS. POSSIBLE LOSS OF CREW/VEHICLE.

CASE 2:

1R/2 2 SUCCESS PATHS. TIME FRAME - ASCENT (PRE MECO).

- 1) LO2 RELIEF SHUTOFF CLOSING SOLENOID VALVE (LV24) PREMATURELY DEACTUATES.
- 2) RELIEF VALVE (RV5) FAILS TO REMAIN CLOSED.

LO2 WILL DUMP OVERBOARD (6200 POUNDS MAXIMUM) RESULTING IN LOSS OF PROPELLANT AND PREMATURE ENGINE SHUTDOWN. FIRE/EXPLOSION HAZARD EXTERIOR TO THE VEHICLE. POSSIBLE VIOLATION OF ET MINIMUM STRUCTURAL REQUIREMENTS DUE TO REDUCED ULLAGE PRESSURE. POSSIBLE LOSS OF CREW/VEHICLE.

-DISPOSITION RATIONALE-

(A) DESIGN:

VALVE IS DESIGNED FOR A PRESSURE FACTOR OF SAFETY OF 2.0 PROOF, 4.0 BURST. THE CLOSURE DEVICE IS A 430 CRES BALL ACTING UPON EITHER OF TWO VESPEL SEATS. THE VALVE FEATURES A BALANCED LOAD ON THE BALL BY APPLYING INLET PRESSURE (750 PSIG NOMINAL) DIRECTLY TO THE BALL AT THE INLET SEAT AND INDIRECTLY (VIA A BELLOWS) THROUGH THE VENT SEAT. THE BELLOWS IS ASSISTED BY A SPRING, THE FORCE OF WHICH INSURES THE BALL IS HELD SECURELY AGAINST THE INLET SEAT WHEN THE SOLENOID IS DEENERGIZED. UPON BEING ENERGIZED THE SOLENOID DEVELOPS THE

**FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE
NUMBER: 03-1-0231-04**

FORCE TO OVERCOME THE SPRING LOAD AND SEATS THE BALL ONTO THE VENT SEAT TO ALLOW HELIUM FLOW. TOTAL POPPET MOVEMENT (STROKE) IS LESS THAN 0.040 INCH.

PREMATURE DEACTUATION MEANS THE FORCE HOLDING THE VALVE BALL TO THE VENT SEAT HAS BEEN REMOVED. MECHANICALLY, THE ONLY VALVE PARTS INVOLVED ARE THE SOLENOID PLUNGER, THE SOLENOID STOP, AND TWO PUSHRODS. THE PLUNGER AND STOP ARE MASSIVE BY COMPARISON TO THE PUSHRODS, AND ARE BOTH OF 430 CRES. THE PUSHRODS ARE ALIGNED IN SERIES WITHIN THE STOP. THE PUSHRODS ARE MADE OF CRES AND CARRY ONLY AXIAL LOADS. IF THE RODS WERE TO FAIL STRUCTURALLY, THEY WOULD CONTINUE TO PERFORM THEIR FUNCTION BECAUSE THEY ARE TOTALLY CONTAINED IN THE STOP (THE ROD O.D. IS 0.125 INCH AND THE STOP I.D. IS 0.126 INCH). THE ROD, IN CONTACT WITH THE BALL, IS GUIDED BY THE SOLENOID STOP FOR OVER 28% OF ITS LENGTH.

THE ONLY OTHER APPARENT WAY TO ACHIEVE PREMATURE DEACTUATION WOULD BE BY STRUCTURAL DAMAGE SUCH THAT A LEAK WOULD BE CREATED OF SUFFICIENT CAPACITY TO VENT THE VALVE ACTUATION PORT THROUGH THE VENT PORT. WITH THE POSSIBLE EXCEPTION OF BALL DISINTEGRATION, NO INTERNAL STRUCTURAL FAILURE WILL CAUSE PREMATURE DEACTUATION BECAUSE THE FAILURE POINT IS DOWNSTREAM OF THE ACTUATION PORT.

IF A VALVE COMPONENT SHOULD FAIL STRUCTURALLY, IT WOULD NOT DISINTEGRATE AND DISAPPEAR. THE FAILURE WOULD CREATE A FLOW PATH FROM THE HIGH PRESSURE SIDE OF THE VALVE TO THE VENT AND SOMEWHERE IN THAT PATH THE FLOW WILL CHOKE. UPSTREAM OF THAT CHOKE POINT (INCLUDING THE ACTUATION PORT), THE PRESSURE WILL REMAIN ABOVE 400 PSIA. THIS RATIONALE ALSO APPLIES TO SEAT AND SEAL DAMAGE. THE BALL IS MADE FROM 430 CRES.

THE SOLENOID STRUCTURE IS CONSTRUCTED OF CRES AND IS EB WELDED. THE COIL IS VACUUM IMPREGNATED (POTTED). THE UNIT IS PRESSURE AND LEAK TESTED AT THE MAJOR ASSEMBLY POINTS.

THE -0022 CONFIGURATION WAS ADDED DUE TO A BELLOWS ASSEMBLY DESIGN CHANGE (P/N 24340 TO P/N 24340-1) TO ELIMINATE THE "SQUIRMED" CONDITION WHICH SOME OF THE ORIGINAL BELLOWS ASSEMBLIES EXPERIENCED DURING PROOF PRESSURE TESTING AT ATP. THE DESIGN CHANGE WAS MADE TO STRENGTHEN THE BELLOWS. BECAUSE THE DAMAGE OCCURRED DURING ATP, VALVES ALREADY IN THE FLEET (-0012 CONFIGURATION) WERE X-RAY TESTED AND ONLY VALVES WHICH HAD SQUIRMED BELLOWS WERE UPGRADED TO THE -0022 CONFIGURATION.

THE -0032 AND -0042 CONFIGURATION SOLENOID VALVES ARE IDENTICAL TO THE -0012 AND -0022 CONFIGURATION SOLENOID VALVES (RESPECTIVELY) WITH THE EXCEPTIONS OF ADDING THE FILTER (10 MICRON NOMINAL, 25 MICRON ABSOLUTE) IN THE VENT PORT OF THE SOLENOID VALVE AND REDESIGN OF THE VENT PORT CHECK VALVE. THIS FILTER WAS ADDED TO PREVENT CONTAMINATION AND METALLIC PARTICLES GENERATED DURING THE REMOVAL OF THE VENT PORT CHECK VALVE DURING OMRSD LEAKAGE MEASUREMENTS FROM ENTERING THE SOLENOID VALVE.

THE VENT PORT CHECK VALVE (P/N 11107-5) WAS REDESIGNED (P/N 11107-7) TO PREVENT THE POPPET FROM BEING EJECTED DUE TO SHEARING OF THE RETAINING NUT THREAD. A PIN WAS ADDED TO THE CHECK VALVE HOUSING, WHICH RETAINS THE POPPET WITHIN

**FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE
NUMBER: 03-1-0231-04**

THE CHECK VALVE HOUSING. A NEW ALUMINUM NUT, WHICH PROVIDES A MINIMUM ENGAGEMENT OF THREE THREADS, WAS UTILIZED TO INCREASE RELIABILITY.

(B) TEST:
ATP

AMBIENT TEMPERATURE TESTS:
PROOF PRESSURE (1560 PSIG); EXTERNAL LEAKAGE (850 PSIG); ELECTRICAL CHARACTERISTICS AND RESPONSE; INTERNAL LEAKAGE (740 PSIG, ENERGIZED AND DEENERGIZED).

REDUCED TEMPERATURE TESTS (-160 DEG F):
ELECTRICAL CHARACTERISTICS AND RESPONSE; INTERNAL LEAKAGE

ELECTRICAL BONDING TESTS

SOLENOID SUBASSEMBLY TESTS:
ELECTRICAL CHARACTERISTICS; ENCLOSURE LEAKAGE (ONE ATMOSPHERE).

CERTIFICATION

TWO UNITS -

PORT AND FITTING TORQUE

SALT FOG EXPOSURE FOLLOWED BY ELECTRICAL AND LEAKAGE CHECKS

AMBIENT VIBRATION TESTS: TOTAL 13.1 HOURS BOTH AXES FOR TWO VIBRATION LEVELS PLUS TRANSIENT VIBRATION SWEEP - RUN WITH ONE UNIT ENERGIZED AND ONE DEENERGIZED - FOLLOWED BY ELECTRICAL CHARACTERISTICS AND LEAKAGE CHECKS

HANDLING SHOCK TEST

ENERGIZED AND DEENERGIZED FLOW TESTS

FIFTY HOUR CONTINUOUS CURRENT TEST AT 130 DEG F

AMBIENT TEMPERATURE ENDURANCE (4500 CYCLES FOLLOWED BY ELECTRICAL AND LEAKAGE CHECKS); 130 DEG F ENDURANCE (500 CYCLES FOLLOWED BY ELECTRICAL AND LEAKAGE CHECKS); OPERATION CYCLES (REPEATED 20 TIMES); REPEAT OF AMBIENT TEMPERATURE ENDURANCE; -160 DEG F ENDURANCE (500 CYCLES FOLLOWED BY ELECTRICAL AND LEAKAGE CHECKS)

DISASSEMBLY AND INSPECTION

BURST PRESSURE (3400 PSIG)

GROUND TURNAROUND TEST
ANY TURNAROUND CHECKOUT IS ACCOMPLISHED IN ACCORDANCE WITH OMRSD.

**FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE
NUMBER: 03-1-0231-04**

(C) INSPECTION:

RECEIVING INSPECTION

RAW MATERIALS ARE VERIFIED BY INSPECTION FOR MATERIAL AND PROCESSES CERTIFICATION. BODY HOUSING BAR STOCK IS ULTRASONICALLY INSPECTED.

CONTAMINATION CONTROL

CLEANLINESS LEVEL VERIFIED TO 100A. CORROSION PROTECTION IS VERIFIED BY INSPECTION.

ASSEMBLY/INSTALLATION

10X MAGNIFICATION EXAMINATION OF ALL DETAIL PARTS FOR BURRS, DAMAGE AND CORROSION IS MADE PRIOR TO ASSEMBLY. ALL DETAIL PARTS ARE INSPECTED FOR DIMENSIONS. CRITICAL SURFACE FINISHES ARE INSPECTED USING A COMPARATOR AT 10X MAGNIFICATION. OTHER SURFACE FINISHES ARE INSPECTED AND VERIFIED WITH A PROFILOMETER. TORQUES ARE VERIFIED TO BE IN ACCORDANCE WITH DRAWING REQUIREMENTS. MANDATORY INSPECTION POINTS ARE INCLUDED IN THE ASSEMBLY PROCEDURE.

CRITICAL PROCESS

WELDING, HEAT TREATMENT AND PARTS PASSIVATION VERIFIED BY INSPECTION. POTTING OF SOLDER CUPS, ELECTRICAL WIRE STRIPPING, AND SOLDERING OF CONNECTORS ARE VERIFIED BY INSPECTION. CHROME PLATING AND DRY FILM LUBRICATION ARE VERIFIED BY INSPECTION.

NONDESTRUCTIVE EVALUATION

WELDS VISUALLY EXAMINED & VERIFIED BY X-RAY AND DYE PENETRANT INSPECTIONS. THE SOLENOID ASSEMBLY IS SUBJECTED TO LEAKAGE VERIFICATION USING RADIOACTIVE TRACER TECHNIQUES. SOME VALVE BODIES WERE SUBJECTED TO 10X MAGNIFICATION INSPECTION ONLY. OTHER VALVE BODIES WERE SUBJECTED TO EDDY CURRENT INSPECTION, IN ADDITION TO 10X MAGNIFICATION. THE REMAINING VALVE BODIES WERE SUBJECTED TO 10X MAGNIFICATION, ETCH AND DYE PENETRANT INSPECTIONS. REFURBISHED VALVE BODIES WERE SUBJECTED TO 40X MAGNIFICATION INSPECTION. BELLOWS ASSEMBLY IS PROOF PRESSURE TESTED AND LEAK CHECKED.

TESTING

ATP VERIFIED BY INSPECTION.

HANDLING/PACKAGING

HANDLING, PACKAGING, STORAGE AND SHIPPING REQUIREMENTS ARE VERIFIED BY INSPECTION.

(D) FAILURE HISTORY:

A NUMBER OF ELECTRICAL CONNECTORS WERE BROKEN AT NSTL DUE TO EXCESSIVE PHYSICAL FORCE APPLIED TO THE CONNECTOR BY TECHNICIANS WORKING IN THE CONFINED AREA (CAR'S AB1813, AB1613, AND AB1208). CORRECTIVE ACTION RESULTED IN THE INSTALLATION OF PROTECTIVE COVERS TO PREVENT CONNECTOR DAMAGE IN HIGH TRAFFIC AREA. ALSO, CONNECTORS WERE WELDED TO THE VALVE BODY IN LIEU OF SOLDERING.

**FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE
NUMBER: 03-1-0231-04**

AN ELECTRICAL SHORT DUE TO INCORRECT ALIGNMENT OF SOLDER CUPS (PINS "A" AND "C") WAS DETECTED AT THE PALMDALE FACILITY (CAR AC2687). THE CORRECTIVE ACTION TAKEN WAS THE ADDITION OF HEAT SHRINK TUBING TO ISOLATE THE SOLDER CUPS AND THE ADDITION OF AN INSPECTION POINT AFTER POTTING.

CURRENT DATA ON TEST FAILURE, FLIGHT FAILURE, UNEXPLAINED ANOMALIES, AND OTHER FAILURES EXPERIENCED DURING GROUND PROCESSING ACTIVITY CAN BE FOUND IN THE PRACA DATABASE.

(E) OPERATIONAL USE:

FLIGHT: NO CREW ACTION CAN BE TAKEN.

GROUND: GROUND OPERATIONS SAFING PROCEDURES CONTAIN SAFING SEQUENCE OF EVENTS FOR MAJOR LEAKS IN THE OXYGEN SYSTEM.

- APPROVALS -

S&R ENGINEERING	: W.P. MUSTY	:/S/ W. P. MUSTY
S&R ENGINEERING ITM	: P. A. STENGER-NGUYEN	:/S/ P. A. STENGER-NGUYEN
DESIGN ENGINEERING	: DAVE NEARY	:/S/ DAVE NEARY
MPS SUBSYSTEM MGR.	: TIM REITH	:/S/ TIM REITH
MOD	: JEFFREY L. MUSLER	:/S/ JEFFREY L. MUSLER
USA SAM	: MICHAEL SNYDER	:/S/ MICHAEL SNYDER
USA ORBITER ELEMENT	: SUZANNE LITTLE	:/S/ SUZANNE LITTLE
NASA SR&QA	: HUGO MARTINEZ	:/S/ HUGO MARTINEZ