

CRITICAL ITEMS LIST (CIL)

SYSTEM:	ASI	FUNCTIONAL CRIT:	1
SUBSYSTEM:	Electrical Cable Trays	PHASE(S):	b
REV & DATE:	J, 12-19-97	HAZARD REF:	S.11
DCN & DATE:			
ANALYSTS:	J. Hicks/E. Howell		

FAILURE MODE: Structural Failure

FAILURE EFFECT: b) Loss of mission and vehicle/crew due to ET structural failure or debris source to Orbiter from support.

TIME TO EFFECT: Immediate

FAILURE CAUSE(S):
 A: Improper Manufacture
 B: Failure of Attaching Hardware

REDUNDANCY SCREENS: Not Applicable

FUNCTIONAL DESCRIPTION: Provide support for fairing between RH SRB and RH vertical strut trays.

<u>FMEA ITEM CODE(S)</u>	<u>PART NO.</u>	<u>PART NAME</u>	<u>QTY</u>	<u>EFFECTIVITY</u>
4.3.92.1	80914003972-010	Fairing Support Assembly	1	LWT-54 & Up

REMARKS:

CRITICAL ITEMS LIST (CIL)
CONTINUATION SHEET

SYSTEM: ASI
SUBSYSTEM: Electrical Cable Trays
FMEA ITEM CODE(S): 4.3.92.1

REV & DATE: J, 12-19-97
DCN & DATE:

RATIONALE FOR RETENTION

DESIGN:

- A, B: The support is machined from 2219-T87 aluminum alloy plate stock. Materials selected for this part number are in accordance with MMC-ET-SE16 which assures repetitive conformance of composition and properties. Surface integrity is assured by penetrant inspection per STP2501.
- A: The support is designed to the required yield (1.1) and ultimate (1.4) safety factors (ET Stress Report 826-2188).
- B: The attaching hardware is selected from the Approved Standard Parts List (ASPL 826-3500). The hardware is installed per STP2014 and torqued using values specified on Engineering drawings. Tensile installation loads are sufficient to provide screening for major flaws in individual fasteners.

TEST:

The Fairing Support Assembly is certified. Reference HCS MMC-ET-TM08-L-S053 (LWT-54 thru 88) and HCS MMC-ET-TM08-L-S503 (LWT-89 & Up).

Vendor:

- B: Attaching fasteners are procured and tested to standard drawings 26L2, 26L3, 33L3 and 34L2.

INSPECTION:

Vendor Inspection-Lockheed Martin Surveillance:

- A, B: Verify materials selection and verification controls (MMC-ET-SE16, drawing 80914003972 and standard drawings 26L2, 33L3, 26L3 and 34L2).
- A: Inspect dimensional conformance (drawing 80914003972).
- A: Penetrant inspect part (drawing 80914003972 and STP2501 Type 1, Method A).

MAF Quality Inspection:

- B: Inspect that attaching hardware is free from damage (drawings 80934003719, 80911031849 and STP2014).
- A, B: Verify installation and witness torque (drawings 80934003719, 80911031849 and STP2014).
- B: Verify locking feature (drawings 80934003719, 80911031849 and STP2014).

FAILURE HISTORY:

Current data on test failures, unexplained anomalies and other failures experienced during ground processing activity can be found in the PRACA data base.