

FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL HARDWARE**NUMBER: 05-6J-2283 -X****SUBSYSTEM NAME:** EPD&C - MAIN PROPULSION SYSTEM**REVISION:** 1 08/02/00

PART DATA

	PART NAME	PART NUMBER
	VENDOR NAME	VENDOR NUMBER
LRU	: AFT LCA-2	MC450-0058-0001
SRU	: DIODE	JANTXV1N5551

EXTENDED DESCRIPTION OF PART UNDER ANALYSIS:

DIODE, BLOCKING (3 AMP), LO2 INBOARD FILL/DRAIN VALVE (PV10), MDM OPEN COMMAND B/MANUAL SWITCH GROUND BLOCKING.

REFERENCE DESIGNATORS: 55V76A122 J3(59)**QUANTITY OF LIKE ITEMS:** 1**FUNCTION:**

ISOLATES MDM OPEN COMMAND B FROM MANUAL SWITCH GROUND, CONDUCTS MANUAL SWITCH OPEN COMMAND TO TYPE III HDC FOR CONTROL OF POWER TO OPEN SOLENOID OF LO2 INBOARD FILL/DRAIN VALVE (PV10).

FAILURE MODES EFFECTS ANALYSIS FMEA -- CIL FAILURE MODE

NUMBER: 05-6J-2283-02

REVISION#: 1 08/02/00

SUBSYSTEM NAME: EPD&C - MAIN PROPULSION SYSTEM

LRU: AFT LCA-2

CRITICALITY OF THIS

ITEM NAME: LO2 I/B F/D VLV OP CMD B BLK DIODE (PV10)

FAILURE MODE: 1R2

FAILURE MODE:

SHORT, INTERNAL SHORT, CURRENT LEAKAGE.

MISSION PHASE:

PL PRE-LAUNCH
LO LIFT-OFF

VEHICLE/PAYLOAD/KIT EFFECTIVITY:

102 COLUMBIA
103 DISCOVERY
104 ATLANTIS
105 ENDEAVOUR

CAUSE:

CONTAMINATION, MECHANICAL SHOCK, VIBRATION, THERMAL STRESS

CRITICALITY 1/1 DURING INTACT ABORT ONLY? YES

RTLS RETURN TO LAUNCH SITE

REDUNDANCY SCREEN

A) PASS
B) PASS
C) PASS

PASS/FAIL RATIONALE:

A)

B)

C)

- FAILURE EFFECTS -

(A) SUBSYSTEM:

LOSS OF POWER TO OPEN SOLENOID DUE TO GROUNDING OF MDM OPEN COMMAND B.

(B) INTERFACING SUBSYSTEM(S):

NO EFFECT - FIRST FAILURE. BISTABLE FEATURE MAINTAINS FILL/DRAIN VALVE IN OPEN POSITION.

**FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE
NUMBER: 05-6J-2283-02**

(C) MISSION:

NO EFFECT - FIRST FAILURE. POSSIBLE LOSS OF CREW/VEHICLE AFTER SECOND FAILURE.

CRIT 1/1 FOR RTLS ABORT

LOSS OF OPEN POWER PREVENTS LO2 DUMP. FAILURE TO ADEQUATELY DUMP LO2 MAY CAUSE VIOLATION OF MAXIMUM DOWNWEIGHT FOR HEAVY MANIFESTED PAYLOADS.

(D) CREW, VEHICLE, AND ELEMENT(S):

SAME AS C.

(E) FUNCTIONAL CRITICALITY EFFECTS:

1R/2 2 SUCCESS PATHS. TIME FRAME – LOADING/DETANK.

- 1) DIODE FAILS SHORT.
- 2) PREMATURE ACTUATION OF THE CLOSE SOLENOID RESULTING IN PREMATURE CLOSURE OF FILL/DRAIN VALVE.

CAUSES TERMINATION OF PROPELLANT LOADING OR DETANKING. RESULTS IN PRESSURE SPIKE WHICH MAY CAUSE RUPTURE OF THE ORBITER FILL LINE, MANIFOLD, AND/OR GSE INTERFACE/FACILITY LINES. POSSIBLE AFT COMPARTMENT OVERPRESSURIZATION AND FIRE/EXPLOSION HAZARD. POSSIBLE LOSS OF ADJACENT CRITICAL FUNCTIONS DUE TO CRYO EXPOSURE. POSSIBLE LOSS OF CREW/VEHICLE.

REF. CIL 03-1-0310-04.

-DISPOSITION RATIONALE-

(A) DESIGN:

REFER TO APPENDIX F, ITEM NUMBER 4 - DIODE.

(B) TEST:

REFER TO APPENDIX F, ITEM NUMBER 4 - DIODE.

GROUND TURNAROUND TEST

ANY TURNAROUND CHECKOUT IS ACCOMPLISHED IN ACCORDANCE WITH OMRSD.

(C) INSPECTION:

REFER TO APPENDIX F, ITEM NUMBER 4 - DIODE.

(D) FAILURE HISTORY:

**FAILURE MODES EFFECTS ANALYSIS (FMEA) -- CIL FAILURE MODE
NUMBER: 05-6J-2283-02**

REFER TO APPENDIX F, ITEM NUMBER 4 - DIODE.

CURRENT DATA ON TEST FAILURE, FLIGHT FAILURE, UNEXPLAINED ANOMALIES, AND OTHER FAILURES EXPERIENCED DURING GROUND PROCESSING ACTIVITY CAN BE FOUND IN THE PRACA DATABASE.

(E) OPERATIONAL USE:

FLIGHT - NO CREW ACTION CAN BE TAKEN.

GROUND - TERMINATE LOADING.

- APPROVALS -

S&R ENGINEERING	: W.P. MUSTY	:/S/ W.P. MUSTY
S&R ENGINEERING ITM	: P. A. STENGER-NGUYEN	:/S/ P.A. STENGER-NGUYEN
DESIGN ENGINEERING	: ANDY RIZVI	:/S/ ANDY RIZVI
MPS SUBSYSTEM MGR.	: TIM REITH	:/S/ TIM REITH
EPD&C SUBSYSTEM MGR.	: RICHARD PHAN	:/S/ RICHARD PHAN
MOD	: BILL LANE	:/S/ BILL LANE
USA SAM	: MIKE SNYDER	:/S/ MIKE SNYDER
USA ORBITER ELEMENT	: SUZANNE LITTLE	:/S/ SUZANNE LITTLE
NASA SR&QA	: BILL PRINCE	:/S/ BILL PRINCE